

XJBMS-BT6T24SV0_V1.0

24串排线短接方法

24-wire connection method

1.准备工作。必须先把排线焊接在电池组上,检查正确后再插到保护板上,不能把排线插到保护板上再一根一根焊在电池组上。


You must first solder the cable to the battery pack, and then plug it into the protection board after checking that it is correct. You cannot plug the cable into the protection board and then solder them one by one to the battery pack.

2.从板子上面B0位置开始接线即排线第一根排线开始,第一根线接第一串负极(总负极开始为第一串)再把第2~25根线依次接到每串的正极(依次顺序排列,第25根线刚好在总正极即24串正极)。

Start wiring from the B0 position on the board, that is, start with the first cable. Connect the first cable to the negative pole of the first string (the total negative pole starts from the first string), and then connect the 2nd to 25th cables to the positive pole of each string in sequence (arranged in sequence, the 25th cable is just at the total positive pole, that is, the positive pole of 24 strings).

3.接线时先接B负再接排线,最后接P负到充电器和负载的负极,电池总正接充电器和电池的正极。

When wiring, first connect B negative and then connect the cable, and finally connect P negative to the negative pole of the charger and load, and the battery positive to the positive pole of the charger and battery.

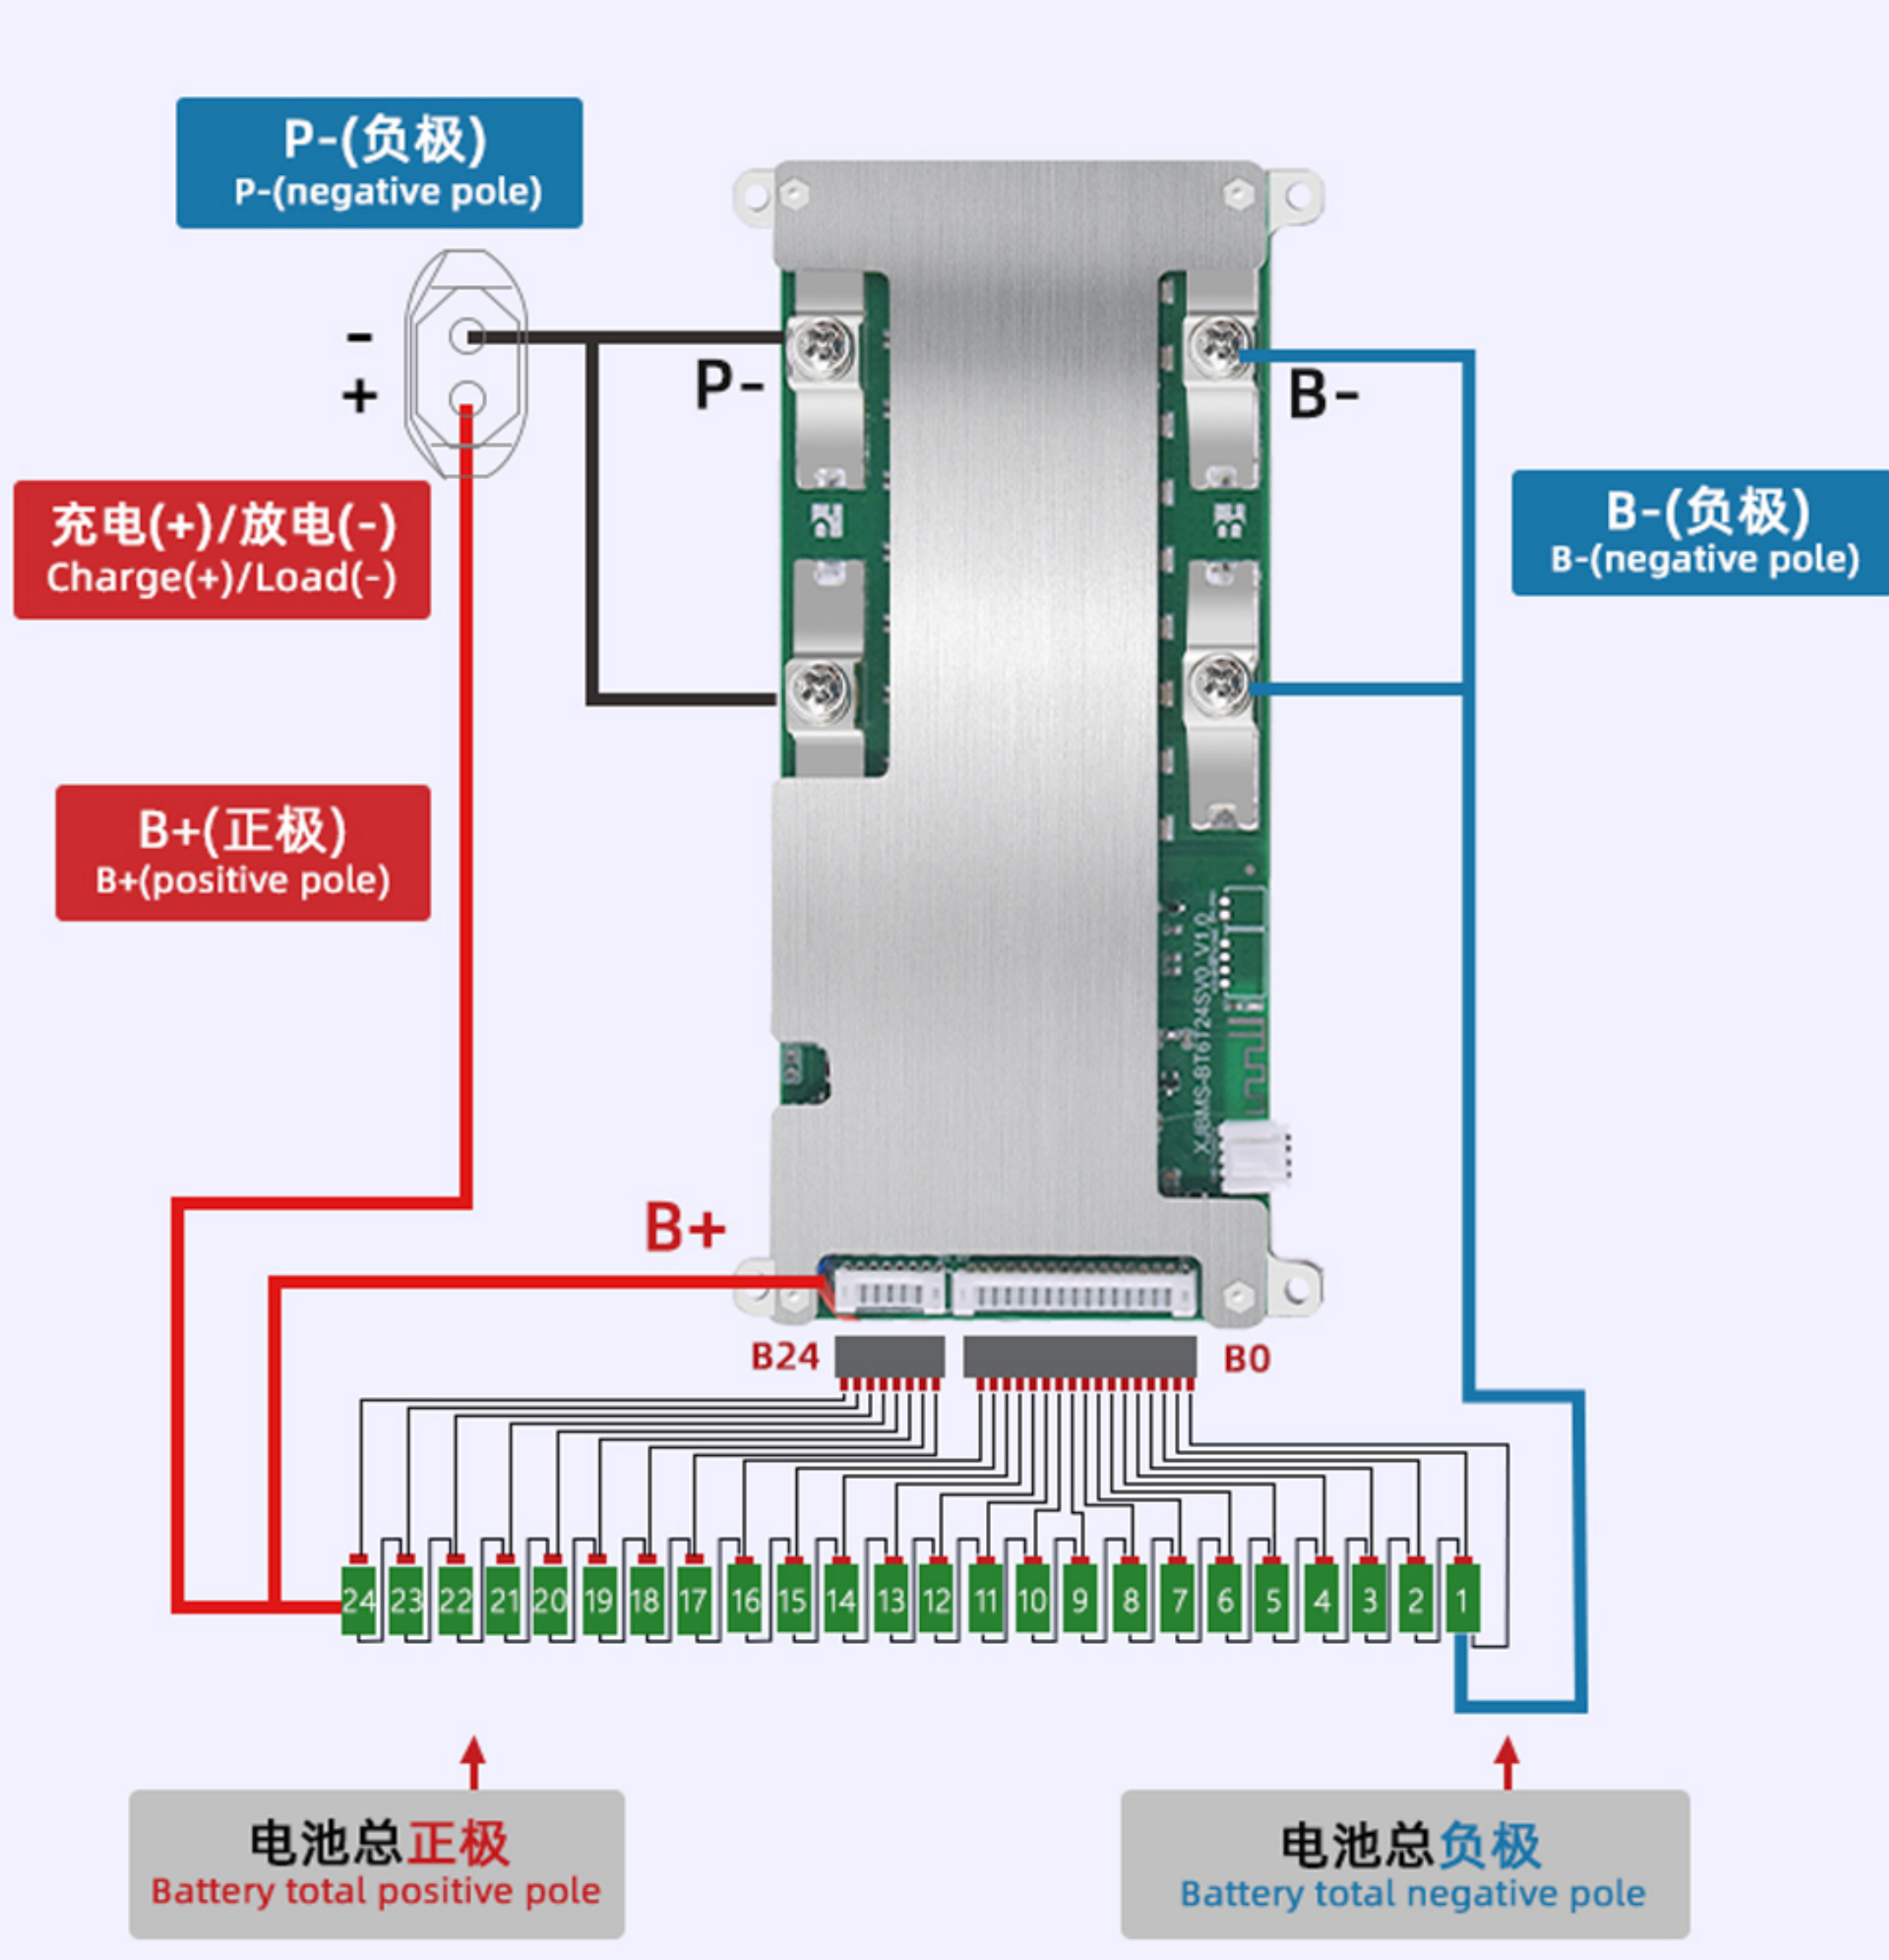


24串排线短接方法

24-wire connection method

从板子上面B0位置开始接线即排线第一根排线开始,第一根线接第一串负极(总负极开始为第一串)再把第2~25根线依次接到每串的正极(依次顺序排列,第25根线刚好在总正极即24串正极)。

Start wiring from the B0 position on the board, that is, start with the first cable. Connect the first cable to the negative pole of the first string (the total negative pole starts from the first string), and then connect the 2nd to 25th cables to the positive pole of each string in sequence (arranged in sequence, the 25th cable is just at the total positive pole, that is, the positive pole of 24 strings).

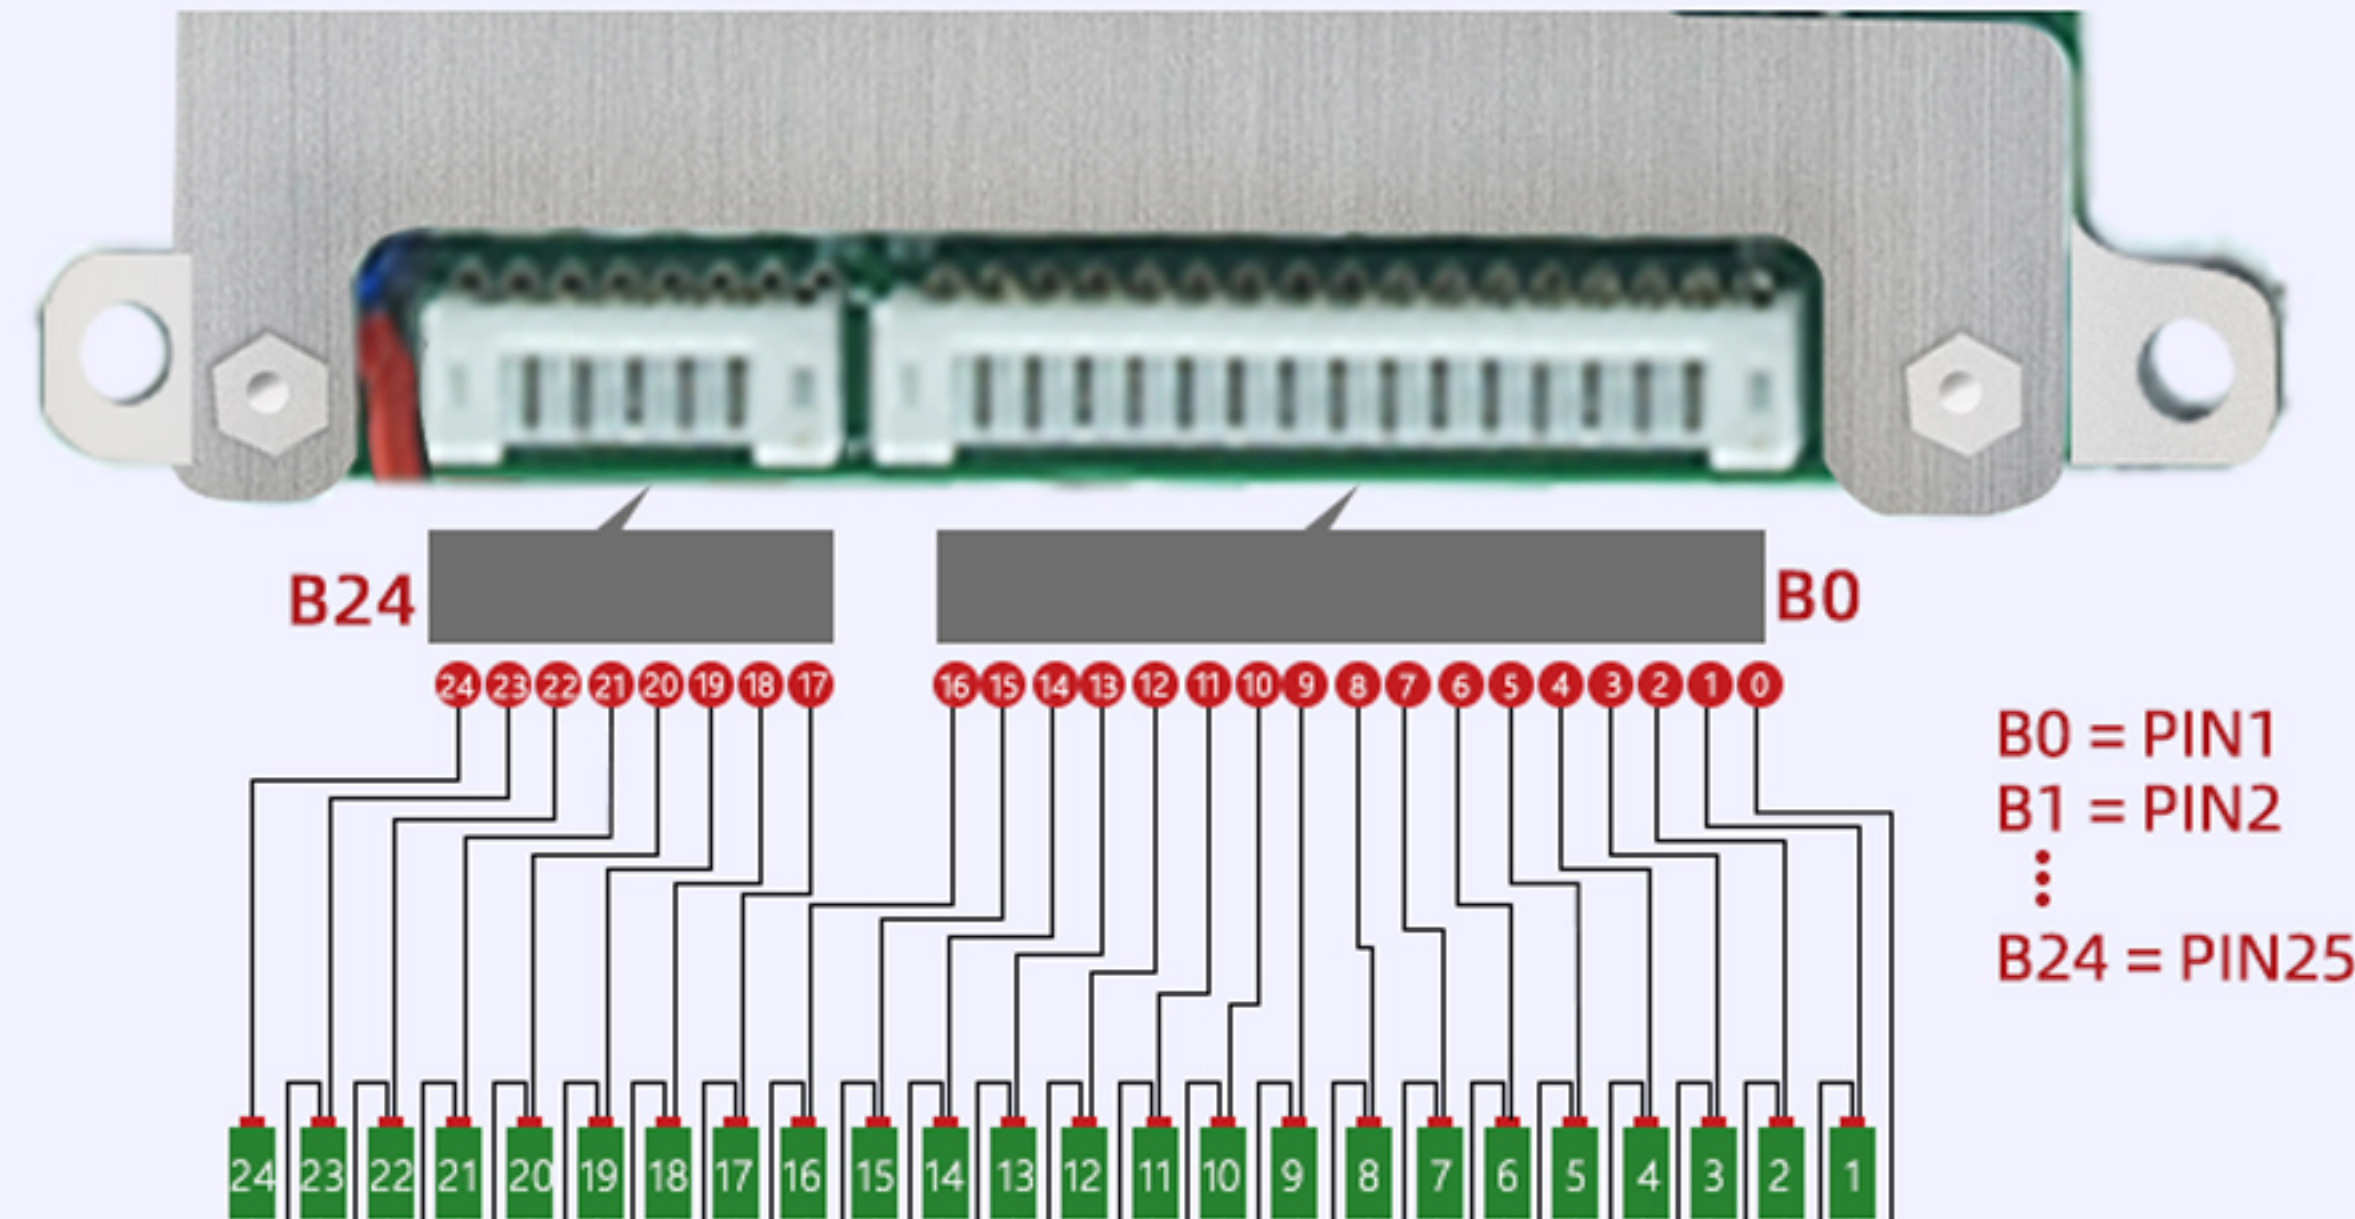


16串排线短接方法

16-wire connection method

从板子上面B0位置开始接线即排线第一根排线开始,第一根线接第一串负极(总负极开始为第一串)再把第2~17根线依次接到每串的正极(依次顺序排列,第17根线刚好在总正极即16串正极)。

Start wiring from the B0 position on the board, that is, start with the first cable. Connect the first cable to the negative pole of the first string (the total negative pole starts from the first string), and then connect the 2nd to 17th cables to the positive pole of each string in sequence (arranged in sequence, the 17th cable is just at the total positive pole, that is, the positive pole of 16 strings).

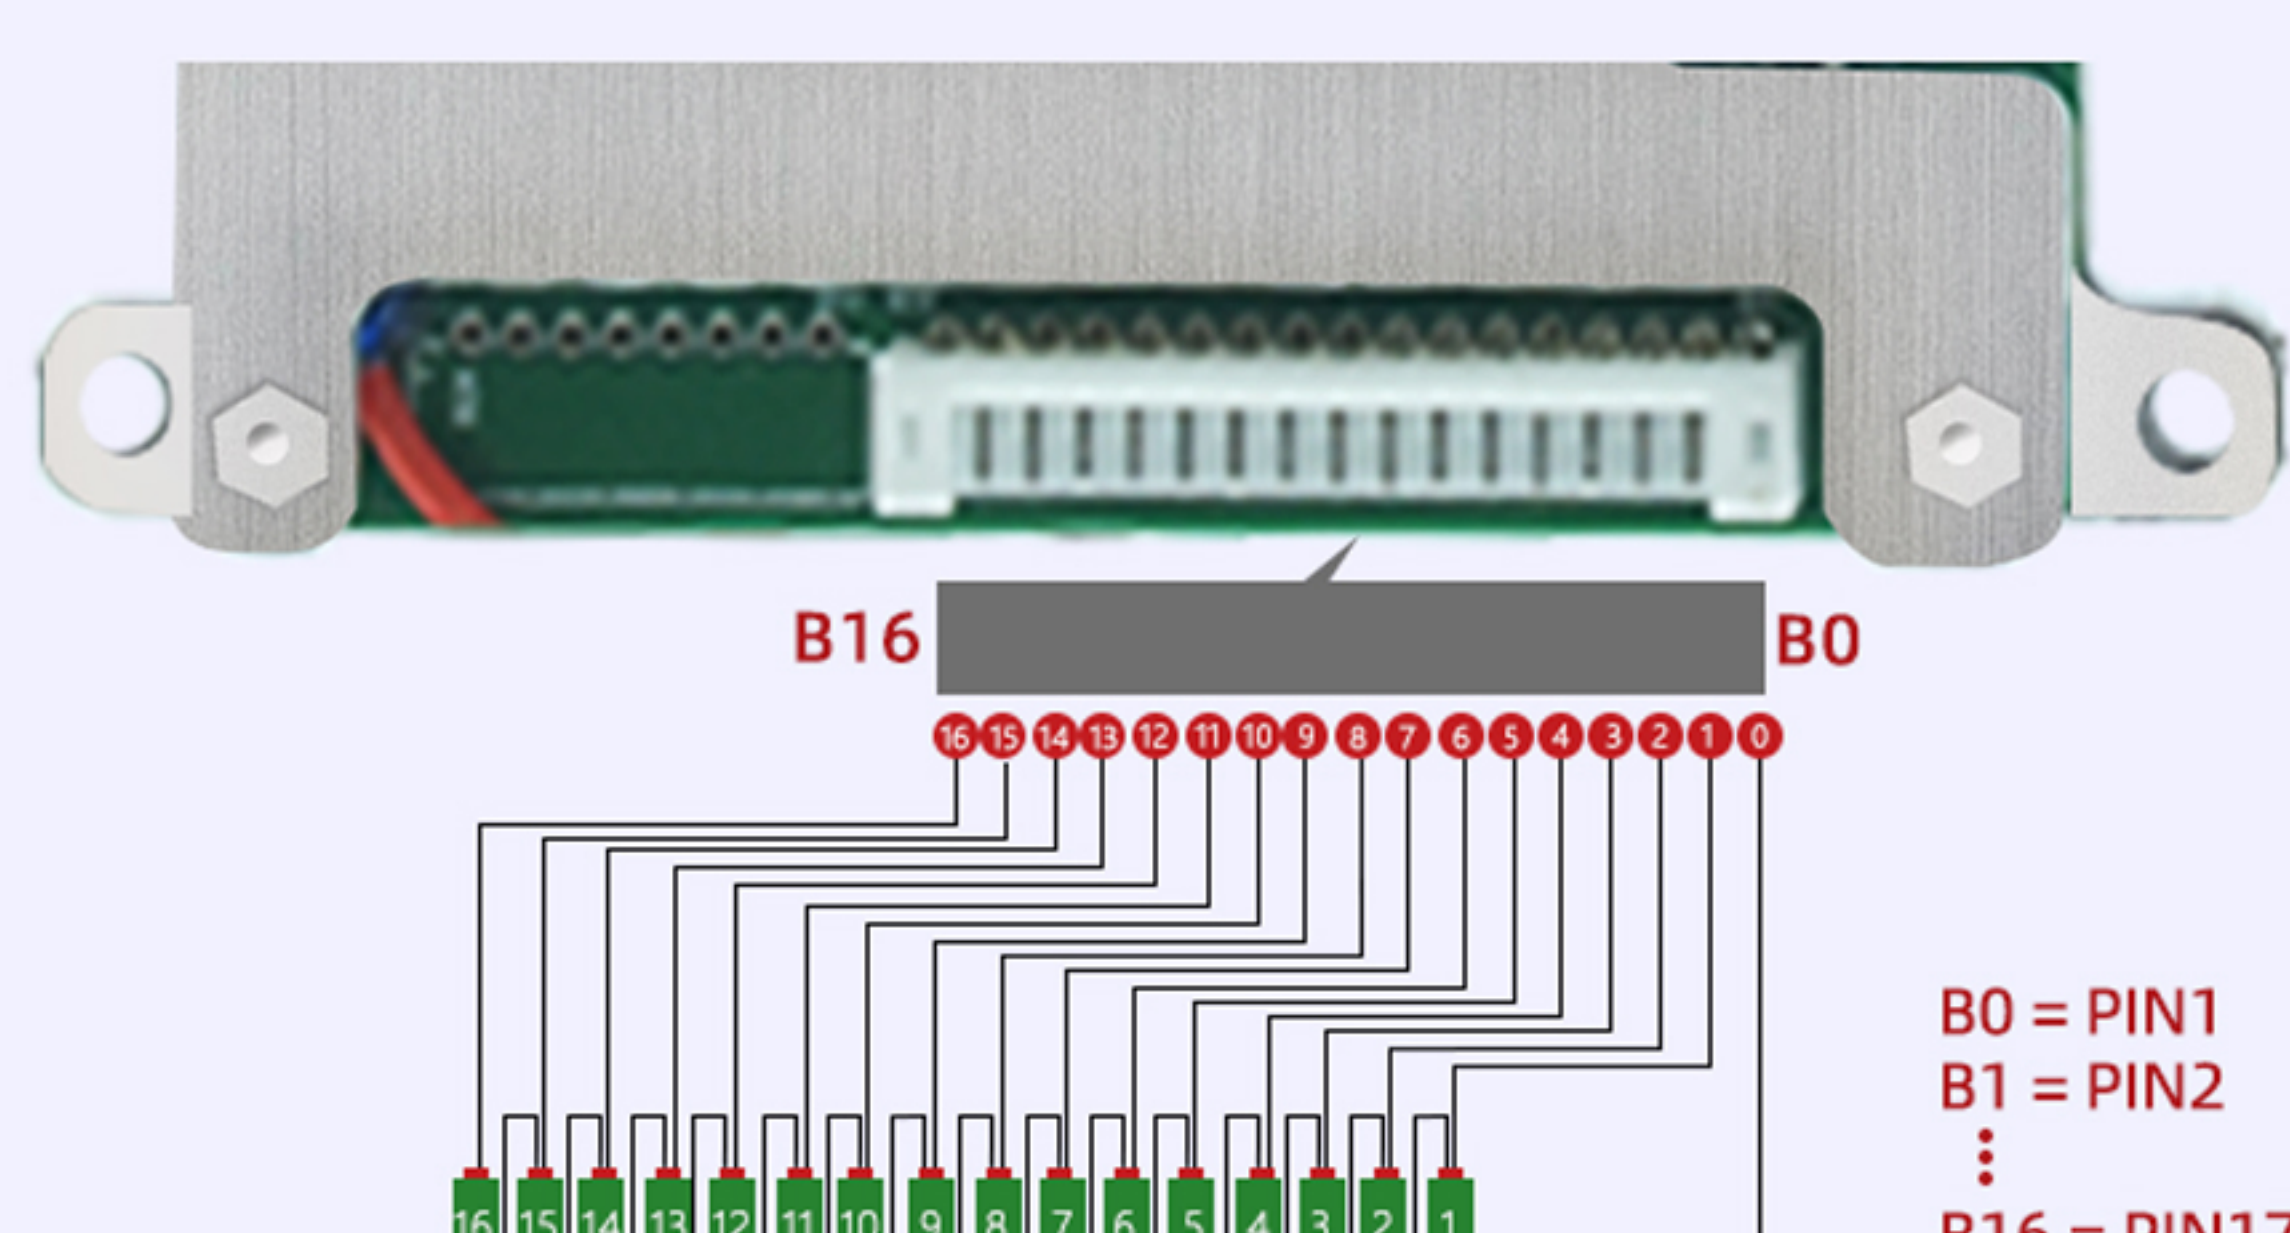

8串排线短接方法

8-wire connection method

从板子上面B0位置开始接线即排线第一根排线开始,第一根线接第一串负极(总负极开始为第一串),再把第2~8根线依次接到每串的正极,同时剩余的接着第9~17根排线短接到总正极,即第9根~17根线都在8串正极上面。

Start wiring from the B0 position on the board, that is, start with the first cable of the cable. Connect the first cable to the negative pole of the first string (the total negative pole starts from the first string), and then connect the 2nd to 8th cables to the positive pole of each string in turn. At the same time, the remaining cables are short-connected to the total positive pole using the 9th to 17th cables, that is, the 9th to 17th cables are all on the positive poles of the 8 strings.

